



POULIES VARIABLES - Section Trapézoïdale

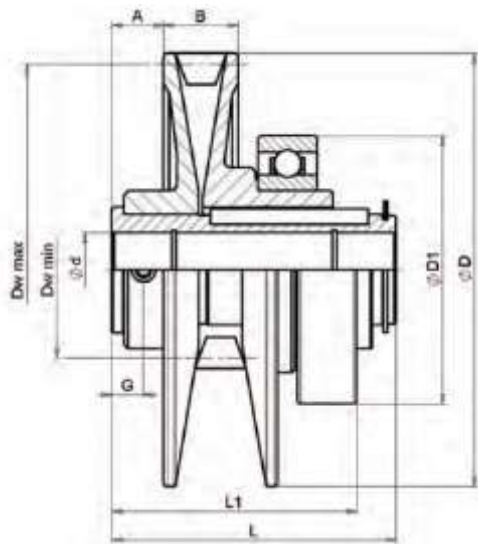

MR	75	110	112	130
Courroie	SPZ/Z	SPA/A	SPA/A	SPB/B
ØD	75	110	110	130
ØD1	62	68	68	75
Dw min	36	44,5	44,5	53
Dw max	71	104,5	104,5	122
Ød1 std	11-14	14-19	14-19	19-24
Ød1 max	20	20	20	24
A	8	13	10	7,5
B min	14	19	19	24
B max	21,7	29	29	36
L	55	72	80	80
L1 min	39	52	45	58,5
L1 max	47	62	55	70,5
G	-	8	8	8
Vis	-	M6	M6	M6

Exemple de commande : MR110-20R

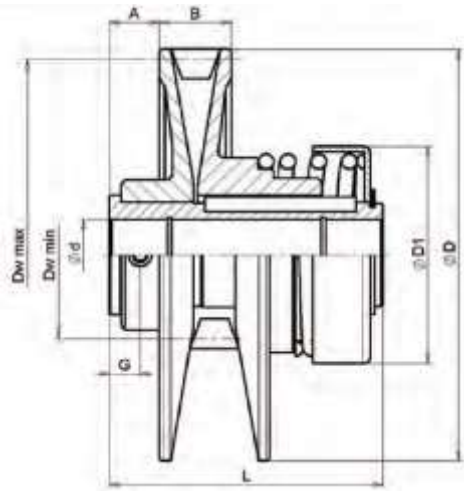


MES	75	110	112	130
Courroie	SPZ/Z	SPA/A	SPA/A	SPB/B
ØD	75	110	110	130
ØD1	58	58	58	58
Dw min	36	44,5	44,5	53
Dw max	71	104,5	104,5	122
Ød min	11-14	14-19	14-19	19-24
Ød max	20	20	20	24
A	8	13	10	36
B min	14	19	19	80
B max	21,7	29	29	8
L	55	72	80	M6
G	-	8	8	8
Vis	-	M6	M6	M6

Exemple de commande : MES112-19R

Courroies spéciales variateurs

		w16	w20		w25		w31.5		w40		w50	w63
Section	13x6	17x6	21x7	23x8	26x8	28x9	33x10	37x10	42x13	47x13	52x16	65x20
Angle	26°	24°	26°	26°	26°	26°	26°	28°	28°	28°	28°	30°
	600	630	630	525	710	650	900	900	1120	1000	1400	1800
	700	710	710	600	800	700	100	850	1250	1060	1600	2000
	800	800	800	650	900	750	1120	900	1400	1120	1900	2240
	900	900	900	700	1000	800	1250	950	1600	1180	2000	2500
		1000	1000	750	1120	850	1400	100	1700	1250	220	2800
			1120	800	1250	900	1600	1060	1800	1320	2500	3150
			1250	850	1400	950	1800	1120	2000	1400	2800	
				900	1600	1000	2000	1180	2240	1500	3150	
				1000		1060		1250	2500	1600		
				1060		1120		1400		1700		
				1120		1180		1500		1800		
				1180		1250		1600		2000		
				1250		1320		1700		2240		
				1320		1400		1800				
				1400		1500		2000				
			1500		1600		2240					

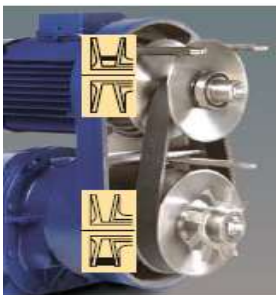

2.20.0